

GPS-8055C Digital Multimeter

GPS-8055C is a 5 ½ digit digital (240,000 count) multimeter incorporating a dual -display and is especially well suited for the needs of high-precision, multifunction and automatic measurement.



GENERAL POLYTRONIC SYSTEMS LTD.
14 REGENTS STREET, LONDON NW10 5LG, UK
TEL: 0044 (0) 20 8960 96 88 FAX: 0044 (0) 20 8964 36 00
E-mail: sales@gpslimited.com

Product Overview

The GPS-8055C is a digital multimeter designed with 5 ½ digits readings resolution and dual-display, especially fitting to the needs of high-precision, multifunction and automatic measurement.

Application fields

- Research Laboratory
- Development Laboratory
- Repair and Maintenance
- Calibration Laboratory
- Automatic Production Test
- General bench-top use

User-Friendly Design

- 4.3" TFT-LCD, 480*272 display
- Supports dual-display, Chinese and English Menu
- Built-in front panel accessible help system
- File management (support for U-disc and local storage)

Math Function

Basic Measurement Function

- DC Voltage: 200 mV - 1000 V
- DC Current: 200 μ A - 10 A
- AC Voltage: True-RMS, 200 mV - 750 V
- AC Current: True-RMS, 20 mA - 10 A
- 2/4-Wire Resistance: 200 Ω - 100 M Ω
- Capacitance: 2 nF - 10000 μ F
- Continuity Test: Range is fixed at 2 k Ω
- Diode Test: Adjustable range is 0 - 4V
- Frequency Measurement: 20 Hz - 1 MHz
- Period Measurement: 1 μ s - 0.05 s
- Temperature: Support for TC and RTD sensor

Math Function

- Max, Min, Average, Standard Deviation, dBm/dB, Relative Measurement, Pass/Fail Histogram, TrendChat


Main Features

- Real 5½ digits readings resolution (240, 000 counts)
- Up to 150 rdgs/s measurement speed
- True-RMS AC Voltage and AC Current measuring
- 1 Gb Nand flash size, Mass storage configuration files and data files
- Built-in cold terminal compensation for thermocouple temperature measurements
- With easy, convenient and flexible PC software: EasyDMM
- Standard interface: USB Device, USB Host, LAN
- Optional Accessories: USB-GPIB Adapter and Scanner Card SC1016
- Support remote control operation via SCPI commands. Compatible with commands of main stream multimeters




Special Features


Histogram

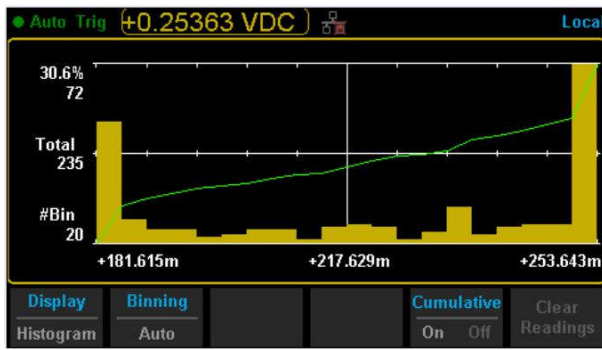


Trend Chart

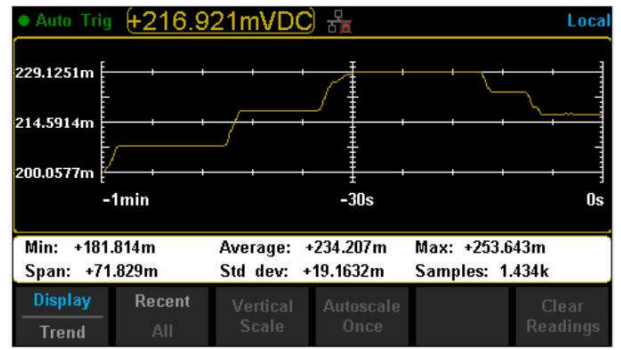

Bar Chart

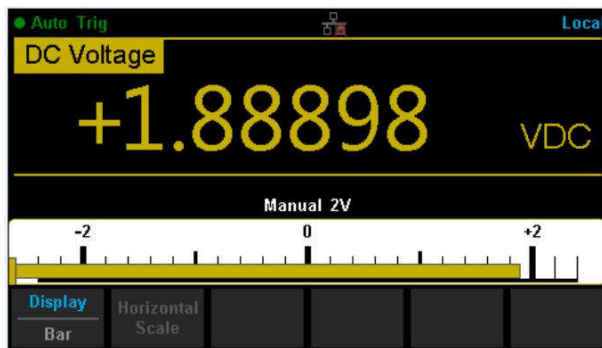

Statistics

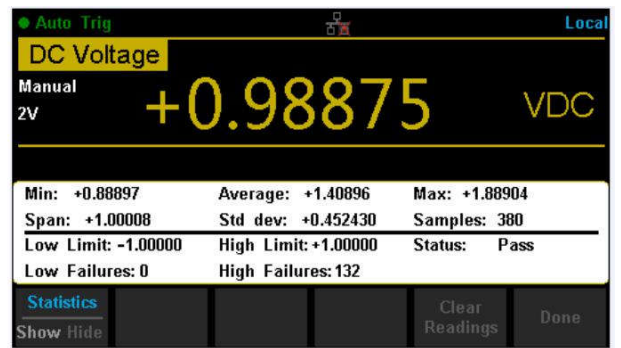

Dual Display



Hold Measurement



dBm Hold Measurement



Interface



Specifications

DC Characteristics

Accuracy ± (% of Reading + % of Range)^[1]

Function	Range ^[2]	Test current or Load voltage	1Year 23°C ± 5°C	Temperature coefficient 0°C ~ 18°C 28°C ~ 50°C
DC Voltage	200 mV		0.015+ 0.004	0.0015+ 0.0005
	2 V		0.015+ 0.003	0.0010+ 0.0005
	20 V		0.015+ 0.004	0.0020+ 0.0005
	200 V		0.015+ 0.003	0.0015+ 0.0005
	1000 V ^[4]		0.015+ 0.003	0.0015+ 0.0005
DC Current	200 µA	< 8 mV	0.055+ 0.005	0.003+ 0.001
	2 mA	< 80 mV	0.055+ 0.005	0.002+ 0.001
	20 mA	< 0.05 V	0.095+ 0.020	0.008+ 0.001
	200 mA	< 0.5 V	0.070+ 0.008	0.005+ 0.001
	2 A	< 0.1 V	0.170+ 0.020	0.013+ 0.001
	10 A ^[5]	< 0.3 V	0.250+ 0.010	0.008+ 0.001
Resistance ^[3]	200 Ω	1 mA	0.030+ 0.005	0.0030+ 0.0006
	2 KΩ	1 mA	0.020+ 0.003	0.0030+ 0.0005
	20 KΩ	100 µA	0.020+ 0.003	0.0030+ 0.0005
	200 KΩ	10 µA	0.020+ 0.010	0.0030+ 0.0005
	2 MΩ	1 µA	0.040+ 0.004	0.0040+ 0.0005
	10 MΩ	200 nA	0.250+ 0.003	0.0100+ 0.0005
	100 MΩ	200 nA 10 MΩ	1.75+ 0.004	0.2000+ 0.0005
Diode Test	2.0 V ^[6]	1 mA	0.05+ 0.01	0.0050+ 0.0005
	4V	100 µA	0.05+ 0.01	0.0050+ 0.0005
Continuity Test	2000 Ω	1 mA	0.05+ 0.01	0.0050+ 0.0005

Remarks:

[1] Specifications are for 0.5 Hour warm-up, "Slow" measurement rate and calibration temperature 18°C ~ 28°C .

[2] 20% over range on all ranges except for DCV 1000 V, ACV 750 V, DCI 10 A and ACI 10 A.

[3] Specifications are for 4-wire measure or 2-wire measure under "REF" operation. ±0.2 Ω of extra errors will be generated if perform 2-wire measure without "REF" operation.

[4] Plus 0.02 mV of error per 1 V after the first ±500 VDC.

[5] 30 seconds OFF after 30 seconds ON is recommend for the continuous current that higher than DC 7 A or AC RMS 7 A.

[6] Accuracy specifications are only for voltage measuring at input terminal. The typical value of current under measure is 1 mA. Voltage drop at diode junction may vary with current supply.

AC Characteristics

Accuracy ± (% of Reading + % of Range)
[1]

Function	Range ^[2]	Frequency Range	1Year 23°C ±5°C	Temperature coefficient 0°C ~ 18°C 28°C ~ 50°C
True-RMS AC Voltage ^[3]	200 mV	20 Hz – 45 Hz	1.5 + 0.10	0.01 + 0.005
		45 Hz – 20 KHz	0.2 + 0.05	0.01 + 0.005
		20 KHz – 50 KHz	1.0 + 0.05	0.01 + 0.005
		50 KHz – 100 KHz	3.0 + 0.05	0.05 + 0.010
	2 V	20 Hz – 45 Hz	1.5 + 0.10	0.01 + 0.005
		45 Hz – 20 KHz	0.2 + 0.05	0.01 + 0.005
		20 KHz – 50 KHz	1.0 + 0.05	0.01 + 0.005
		50 KHz – 100 KHz	3.0 + 0.05	0.05 + 0.010
	20 V	20 Hz – 45 Hz	1.5 + 0.10	0.01 + 0.005
		45 Hz – 20 KHz	0.2 + 0.05	0.01 + 0.005
		20 KHz – 50 KHz	1.0 + 0.05	0.01 + 0.005
		50 KHz – 100 KHz	3.0 + 0.05	0.05 + 0.010
	200 V	20 Hz – 45 Hz	1.5 + 0.10	0.01 + 0.005
		45 Hz – 20 KHz	0.2 + 0.05	0.01 + 0.005
		20 KHz – 50 KHz	1.0 + 0.05	0.01 + 0.005
		50 KHz – 100 KHz	3.0 + 0.05	0.05 + 0.010
750 V	20 Hz – 45 Hz	1.5 + 0.10	0.01 + 0.005	
	45 Hz – 20 KHz	0.2 + 0.05	0.01 + 0.005	
	20 KHz – 50 KHz	1.0 + 0.05	0.01 + 0.005	
	50 KHz – 100 KHz	3.0 + 0.05	0.05 + 0.010	
True-RMS AC Current ^[4]	20 mA	20 Hz – 45 Hz	1.5 + 0.10	0.015 + 0.015
		45 Hz – 2 KHz	0.50 + 0.10	0.015 + 0.006
		2 KHz – 10 KHz	2.50 + 0.20	0.015 + 0.006
	200 mA	20 Hz – 45 Hz	1.5 + 0.10	0.015 + 0.005
		45 Hz – 2 KHz	0.50 + 0.10	0.015 + 0.005
		2 KHz – 10 KHz	2.50 + 0.20	0.015 + 0.005
	2 A	20 Hz – 45 Hz	1.5 + 0.20	0.015 + 0.005
		45 Hz – 2 KHz	0.50 + 0.20	0.015 + 0.005
		2 KHz – 10 KHz	2.50 + 0.20	0.015 + 0.005
	10 A ^[5]	20 Hz – 45 Hz	1.5 + 0.15	0.015 + 0.005
		45 Hz – 2 KHz	0.50 + 0.15	0.015 + 0.005
		2 KHz – 10 KHz	2.50 + 0.20	0.015 + 0.005

Additional wave crest factor error (not Sine) [6]

Wave crest coefficient	Error (% Range)
1-2	0.05
2-3	0.2

Remarks:

[1] Specifications are for 0.5 Hour warm-up, "Slow" measurement rate and calibration temperature 18°C ~28°C .

[2] 20% over range on all ranges except for DCV 1000 V, ACV 750 V, DCI 10 A and ACI 10 A.

[3] Specifications are for amplitude of sine wave input > 5% of range. For inputs from 1% to 5% of range and <50 kHz, add 0.1% of range extra error. For 50 kHz to 100 kHz, add 0.1% of range extra error.

[4] Specifications are for sine wave input > 5% of range. 0.1% errors will be added when the range of input sine wave is 1% to 5% .

[5] 30 seconds OFF after 30 seconds ON is recommend for the continuous current that higher than DC 7 A or AC RMS 7 A.

[6] For frequency < 100Hz



Frequency and Period CharacteristicAccuracy± (% of Reading + % of Range)^[1]

Function	Range	Frequency Range	1 Year 23°C ±5°C	Temperature coefficient 0°C ~ 18°C 28°C ~ 50°C
Frequency /Period	200 mV ~750 V ^[2]	20 Hz – 2 KHz	0.01+0.003	0.002+0.001
		2 KHz – 20 KHz	0.01+0.003	0.002+0.001
		20 KHz – 200 KHz	0.01+0.003	0.002+0.001
		200 KHz –1 MHz	0.01+0.006	0.002+0.002

Remarks:

[1] Specifications are for 0.5 Hour warm-up.

[2] Except for special marks, the AC input voltage is 15% to 120% of range when <100 kHz and 30% to 120% of range when >100 kHz. 750 V range is limited to 750 Vrms. The accuracy is 10 times % of reading when the measurement range of AC voltage is in 200 mV range

Capacitance CharacteristicAccuracy± (% of Reading + % of Range)^[1]

Function	Range ^[2]	Max Testing Current	1 Year 23°C ±5°C	Temperature coefficient 0°C ~ 18°C 28°C ~ 50°C
Capacitance	2 nF	200 nA	3+1.0	0.08+0.002
	20 nF	200 nA	1+0.5	0.02+0.001
	200 nF	2 µA	1+0.5	0.02+0.001
	2 µF	10 µA	1+0.5	0.02+0.001
	200 µF	100 µA	1+0.5	0.02+0.001
	10000 µF	1 mA	2+0.5	0.02+0.001

Remarks:

[1] Specifications are for 0.5 Hour warm-up and "REF" operation. Using of non-film capacitor may generate additional errors.

[2] Specifications are for from 1% to 120% on 2 nF range and ranges from 10% to 120% on other ranges.

Temperature CharacteristicAccuracy± (% of Reading + % of Range)^[1]

Function	Probe Type	Probe Model	Working Temperature Range	1Year 23°C ±5°C	Temperature coefficient 0°C ~18°C 28°C ~50°C
Temperature	RTD ^[2]	α=0.00385	-200°C ~ 660°C	0.16°C	0.08+0.002
		B	0°C~ 1820°C	0.76 °C	0.14°C
	TC ^[3]	E	-270°C~ 1000°C	0.5°C	0.02°C
		J	-210°C~ 1200°C	0.5°C	0.02°C
		K	-270°C~ 1372°C	0.5°C	0.03°C
		N	-270°C~ 1300°C	0.5°C	0.04°C
		R	-270°C~ 1768°C	0.5°C	0.09°C
		S	-270°C~ 1768°C	0.6°C	0.11°C
		T	-270°C~ 400°C	0.5°C	0.03°C

Remarks:

[1] Specifications are for 0.5 Hour warm-up, not include probe error.

[2] Specifications are for 4-wire measure or 2-wire measure under "REF" operation.

[3] Built-in cold terminal compensation for thermocouple, accuracy is ±2°C .

Measuring Method and other Characteristics

DC Voltage	
Input Resistance	200 mV and 2 V Range 10 M Ω or >10 G Ω selectable
	20 V, 200 V and 1000 V Range 10 M Ω \pm 2%
Input Bias Current	<90 pA, 25°C
Input Protection	1000 V on all ranges
CMRR	120 dB (For the 1 K Ω unbalanced resistance in LO lead, max \pm 500 VDC)
NMRR	60 dB at "slow" measurement rate
	20 dB are added if open the "AC" filter.
Resistance	
Testing Method	4-wire resistance or 2-wire resistance selectable
Input Protection	1000 V on all ranges
DC Current	
Shunt Resistor	200 μ A sampling voltage < 8 mV
	2 mA sampling voltage < 8 mV
	1 Ω for 20 mA, 200 mA 1 Ω
	0.01 Ω for 2 A, 10 A
Input Protection	Rear panel : accessible 10 A,250 V fast-melt fuse Internal :12 A,250 V slow-melt fuse
Continuity/Diode Test	
Measurement Method	1 mA \pm 5% constant-current source or open-circuit voltage
Beeper	yes
Continuity Threshold	Adjustable
Input Protection	1000 V
True-RMS AC Voltage	
Measurement Method	AC Coupled true RMS measure – up to 1000 V DC bias are permitted on every range.
Wave Crest Factor	\leq 3 at full scale
Input Impedance	1 M Ω \pm 2% in parallel with <100 pF on all ranges
AC Filter Bandwidth	20 Hz \sim 100 KHz
CMRR	60 dB (For the 1 K Ω imbalance resistance among Lo lead and <60 Hz, Max \pm 500 VDC)
True-RMS AC Current	
Measurement Method	DC Coupled to the fuse and shunt; AC Coupled the True-RMS measurement (measures the AC components only)
Wave Crest Factor	\leq 3 at full scale
Max Input	<10 A (include DC component)
Shunt Resistor	1 Ω for 20 mA, 200 mA 1 Ω ; 0.01 Ω for 2 A, 10 A
Input Protection	Rear panel : accessible 10 A,250 V fast-melt fuse Internal :12 A,250 V slow-melt fuse
Frequency/Period	
Measurement Method	Reciprocal-counting technique, AC Coupled input, AC voltage or AC current measurement function
Measure Attentions	Errors are leaded into all frequency counters when measuring low voltage or loe frequency signal.

Capacitance Measuring

Measurement Method	Measure the rate of change of voltage generated during the current flowing the capacitance
Connection Type	2-wire
Input Protection	1000 V on all ranges

Temperature Measuring

Measurement Method	Support for TC and RTD types of sensor
--------------------	--

Trigger and Memory

Samples/Trigger	1~10000	
Trigger Delay	6 ms~10000 ms optional	
External Trigger Input	Input Level	TTL compatible (High level when left input terminal is hanging in the air)
	Trigger Condition	Rising and Falling selectable
	Input Impedance	$\geq 20\text{ K}\Omega//400\text{ pF}$, DC-coupled
	Min Pulse	500 us
VMC	Level	TTL compatible
	Output Polarity	Positive and negative optional
	Output Impedance	200 Ω , typical

History Records

Volatile Memory	10 K reading of history records
Nonvolatile Memory	1 Gb Nand Flash, Mass storage configuration files and data files, Support U-disk external storage

Math Functions

Min/Max/Average, dBm, dB, Pass/Fail, Relative, Standard deviation, Hold, histogram, Trend chart, Bar chart

General Specifications

Power Supply	
AC 100 V ~ 120 V	50/60 Hz
AC 200 V ~ 240 V	50/60 Hz
Consumption	20 VA max
Mechanism	
Dimension	282 mm×260 mm×105 mm
Weight	3.33 Kg
Other Characteristics	
Display Screen	4.3" TFT-LCD with resolution 480*272
Operation Environment	Full accuracy from 0°C to 50°C , 80% RH and 40°C , non condensing
	Storage Temperature: -20°C -70°C
	Shock and Vibration: conforming to MIL-T-28800E, 5 level (only for sine)
	Height above sea level: up to 3000 meters
Safety	Conforming to IEC61010-1:2001. Measure CAT I 1000 V/CAT II 600V Class of pollution: 2
Remote Interface	USB-GPIB, 10/100 Mbit LAN, USB2.0 Full Speed Device&Host
Programing Language	Standard SCPI, compatible with commands of main stream multimeters
Warm Up Time	30 minutes

Ordering Information

Standard Accessories	
Power Cord	-1
USB Cable	-1
Quick Start	-1
warranty Card	-1
EasyDMM ^[1]	software system
Test Leads and Alligator Clips	-2
Optional Accessories	
USB-GPIB adapter	USB-GPIB
Scanner Card SC1016	Needed to be installed in factory

[1] The latest version of EasyDMM can be downloaded for free from the GPS-8000 series of digital multimeter